



## Airworthiness Directive

**AD No.:** 2019-0208

**Issued:** 22 August 2019

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

### Design Approval Holder's Name:

AIRBUS HELICOPTERS DEUTSCHLAND GmbH

### Type/Model designation(s):

MBB-BK117 D-2 helicopters

**Effective Date:** 29 August 2019

**TCDS Number(s):** EASA.R.010

**Foreign AD:** Not applicable

**Supersedure:** This AD supersedes EASA AD 2017-0238 dated 30 November 2017 and EASA AD 2018-0230 dated 23 October 2018.

## ATA 42 – Integrated Modular Avionics – Aircraft Management Computer Software – Update

### Manufacturer(s):

Airbus Helicopters Deutschland GmbH (AHD), formerly Eurocopter Deutschland GmbH

### Applicability:

MBB-BK117 D-2 helicopters, all serial numbers.

### Definitions:

For the purpose of this AD, the following definitions apply:

**The ASB:** Airbus Helicopters (AH) Alert Service Bulletin (ASB) MBB-BK117 D-2-42A-005 Revision 3.

**Affected part:** Aircraft Management Computers (AMC), having a software (SW) version installed, identified as “pre-mod SW” in Table 2 of this AD, or earlier.

**Groups:** Group 1 helicopters are those that have an affected part installed.

Group 2 helicopters are those that do not have an affected part installed.

### Reason:

An occurrence was reported of erroneous low rotor revolutions per minute (RPM) indication after establishing One Engine Inoperative (OEI) condition.



This condition, if not corrected, could lead to inappropriate pilot response during operations in OEI condition, possibly resulting in damage to the helicopter and/or injury to occupants.

To address this unsafe condition, pending an AMC SW modification, Airbus Helicopters (AH) issued certain Rotorcraft Flight Manual (RFM) Temporary Revisions (TR), updating the “Emergency and malfunction procedures” section of the applicable RFM, and EASA issued AD 2017-0238 requiring amendment of the MBB-BK 117 D2 RFM.

Since that AD was issued, AH developed an upgraded AMC SW, which prevents further occurrences, and issued the ASB providing instructions to update the SW of affected parts.

For the reasons described above, this AD retains the requirements of EASA AD 2017-0238, which is superseded, and requires updating the AMC SW. This AD also supersedes EASA AD 2018-0230 that required installation of a previous AMC SW version, which was developed to address a different unsafe condition.

#### Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

#### Restatement of Requirements of EASA AD 2017-0238

##### RFM Amendment:

- (1) For Group 1 helicopters: Within 14 days after 07 December 2017 [the effective date of EASA AD 2017-0238], amend section 3 of the RFM, “Emergency and malfunction procedures”, by inserting a copy of the RFM TR as identified in Table 1 of this AD, as applicable, inform all flight crews and, thereafter, operate the helicopter accordingly.

Table 1 – RFM Temporary Revision

MBB-BK 117 D-2 Configuration	RFM Temporary Revision	RFM Revision
D-2 and D-2m (basic)	TR No. 2, dated 20 November 2017	See Note 1 of this AD
D-2 (Helionix Step 2)	TR No. 2, dated 20 November 2017	RFM Revision 16
D-2m (Helionix Step 2)	TR No. 2, dated 20 November 2017	RFM Revision 9

Note 1: On the effective date of this AD, no D-2 and D-2m (basic) helicopters are known to be in service.

- (2) Amending the “Emergency and malfunction procedures” section of the applicable RFM of a helicopter by incorporating RFM revision as identified in Table 1 of this AD, as applicable, or later revision, is an acceptable method to comply with the RFM amendment requirement of paragraph (1) of this AD for that helicopter.



**Partial Restatement of Requirements of EASA AD 2018-0230****Modification:**

- (3) For Group 1 helicopters that have AMC installed, having SW version V5.0.2, part number (P/N) D462C01S0502 or P/N D462C03S0502, or earlier: Within 2 months after 06 November 2018 [the effective date of EASA AD 2018-0230], update the SW of each AMC in accordance with the instructions of Section 3.B of AH ASB MBB-BK117 D-2-42A-004.

**New Requirements of this AD****Modification:**

- (4) For Group 1 helicopters: Within 2 months after the effective date of this AD, update the SW of each affected part to the corresponding upgraded SW, as listed in Table 2 of this AD, in accordance with the instructions of Section 3.B.2 of the ASB.

Table 2 – AMC SW update

Helicopter Configuration	Pre-mod SW	Upgraded SW
D-2 and D-2m (basic)	See Note 1 of this AD	
D-2 and D-2m (Helionix Step 2)	V5.0.1 P/N D462C01S0501	V5.0.4 P/N D462C01S0504
	V5.0.2 P/N D462C01S0502	V5.0.4 P/N D462C01S0504
	V5.0.2 P/N D462C03S0502	V5.0.4 P/N D462C03S0504
D-2 and D-2m (Helionix Step 2.0.1)	V5.0.3 P/N D462C01S0503	V5.0.4 P/N D462C01S0504
	V5.0.3 P/N D462C03S0503	V5.0.4 P/N D462C03S0504
D-2 and D-2m (Helionix Step 3)	V6.0 P/N D462C01S0600	V6.0.2 P/N D462C01S0602
	V6.0 P/N D462C03S0600	V6.0.2 P/N D462C03S0602

- (5) Replacement on a helicopter of an affected part with an AMC having installed the corresponding upgraded SW as listed in Table 2 of this AD, or later SW upgrade, in accordance with instructions provided by AH, is an acceptable alternative method to comply with the requirements of paragraph (4) of this AD for that helicopter.
- (6) Modification of a helicopter as required by paragraph (4) of this AD constitutes compliance with the requirements of paragraph (3) of this AD for that helicopter.

**Parts Installation:**

- (7) Do not install on any helicopter an affected part, and do not upload any SW identified as “pre-mod SW” in Table 2 of this AD, or earlier SW version, on any AMC, as required by paragraph (7.1) or (7.2) of this AD, as applicable.

(7.1) For Group 1 helicopters: After modification of that helicopter as required by paragraph (4) of this AD.

(7.2) For Group 2 helicopters: From the effective date of this AD.



- (8) From the effective date of this AD, do not install on any helicopter an AMC, having installed SW version V5.0.2, P/N D462C01S0502 or P/N D462C03S0502, or earlier SW version, and do not upload on any AMC a SW version earlier than V5.0.3.

**RFM Amendment:**

- (9) After modification of a Group 1 helicopter as required by paragraph (3) of this AD, it is allowed to remove the RFM TR listed in Table 3 of this AD, as applicable, previously inserted as required by paragraph (1) of EASA AD 2018-0230, from the RFM of that helicopter. This can be accomplished by incorporating RFM revision as identified in Table 3 of this AD, as applicable, or later revision in the applicable RFM.

Table 3 – RFM Temporary Revision

<b>MBB-BK117 D-2 Configuration</b>	<b>RFM Temporary Revision</b>	<b>RFM Revision</b>
D-2 (basic)	TR No. 1, dated 28 March 2017	See Note 1 of this AD
D-2m	TR No. 2, dated 28 March 2017	See Note 1 of this AD
D-2 (Helionix Step 2)	TR No. 1, dated 28 March 2017	RFM revision 10
D-2m (Helionix Step 2)	TR No. 1, dated 28 March 2017	RFM Revision 7

- (10) Before next flight after modification of a Group 1 helicopter as required by paragraph (4) of this AD, remove the RFM TR listed in Table 1 of this AD, previously inserted as required by paragraph (1) of this AD, from the RFM of that helicopter, inform all flight crews and, thereafter, operate the helicopter accordingly.
- (11) Amending the “Emergency and malfunction procedures” section of the applicable RFM of a helicopter by incorporating RFM revision as identified in Table 1 of this AD, as applicable, or later revision, is an acceptable method to comply with the RFM amendment requirement of paragraph (10) of this AD for that helicopter.

**Ref. Publications:**

AH Flight Manual BK117 D-2, TR No. 2, dated 20 November 2017.

AH Flight Manual BK117 D-2 (Helionix Step 2), TR No. 2, dated 20 November 2017.

AH Flight Manual BK117 D-2m (Helionix Step 2), TR No. 2, dated 20 November 2017.

AH ASB MBB-BK117 D-2-42A-004 original issue dated 04 September 2018.

AH ASB MBB-BK117 D-2-42A-005 Revision 3 dated 06 June 2019.



The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

**Remarks:**

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 22 July 2019 as PAD 19-134 for consultation until 05 August 2019. No comments were received during the consultation period.
3. Enquiries regarding this AD should be referred to the EASA Programming and Continued Airworthiness Information Section, Certification Directorate. E-mail: [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu).
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#).
5. For any question concerning the technical content of the requirements in this AD, please contact: Airbus Helicopters Deutschland GmbH, Industriestrasse 4, 86609 Donauwörth, Federal Republic of Germany, Telephone: + 33 (0)4 42 85 97 97;  
Web portal: <https://keycopter.airbushelicopters.com> > Technical Request Management  
E-mail: [customersupport.helicopters@airbus.com](mailto:customersupport.helicopters@airbus.com).

